

AD-A048 662

LITTON SYSTEMS INC MORRIS PLAINS N J AIRTRON DIV  
MANUFACTURING METHODS AND TECHNOLOGY ENGINEERING FOR NEODYMIUM --ETC(U)  
OCT 77 D DENTZ

F/6 20/5  
DAAB07-77-C-0375

NL

UNCLASSIFIED

| OF |  
AD:  
A048662



END  
DATE  
FILED  
2-78  
DDC

ADA048662



## Unclassified

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (If Sensitive)		4. PERIOD OF REPORT & PERIOD COVERED
Manufacturing Methods and Technology Engineering for Neodymium Doped YAG Laser Rods.		Quarterly Progress Report no. 2, June 30 - 31 Aug 1977
7. AUTHOR(s)	8. CONTRACT OR GRANT NUMBER(s)	5. REPORTING UNITS REPORT NUMBER
D. Dentz	DAAB07-77-C-0375	(15)
9. PERFORMING ORGANIZATION NAME AND ADDRESS	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS	
Litton Airtron division Litton Systems, Inc 200 East Hanover Avenue Morris Plains, New Jersey 07950	2779751	
11. CONTROLLING OFFICE NAME AND ADDRESS	12. REPORT DATE	13. NUMBER OF PAGES
Technical Programs and Systems Development U.S. Army Electronics Command /Division Fort Monmouth, New Jersey 07703	Oct 1977	12 18p.
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)	15. SECURITY CLASS. (of this report)	
Attn: DRSEL-RD-PC Mr. J. Sanders	Unclassified	
16. DISTRIBUTION STATEMENT (of this Report)	16. DECLASSIFICATION/DOWNGRADING SCHEDULE	
Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES	DDC REF ID: A JAN 16 1978	
19. KEY WORDS (Continue on reverse side if necessary and identify by block number)	A	
Nd:YAG Laser rod		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number)		
The polishing fixture designed to hold sixteen rods during fabrication was received during this quarter. Using this fixture several lots of rods were processed to evaluate the proposed polishing process. Process data, times and yields were obtained. Rods were measured for adherence to specifications and data collected as a function of rod position within the block.		

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

209175

*[Signature]*

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

---

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

**Manufacturing Methods and Technology  
Engineering for Neodymium Doped YAG Laser Rods**

**D. Dentz**

**Second Quarterly Progress Report  
June 1, 1977 to August 31, 1977**

**Contract No. DAAB07-77-C-0375**

ACCESSION NO.	
NTIS	White Section <input checked="" type="checkbox"/>
DOC	Buff Section <input type="checkbox"/>
UNANNOUNCED <input type="checkbox"/>	
JUSTIFICATION .....	
BY .....	
DISTRIBUTION/AVAILABILITY CODES	
Dist.	AVAIL. and/or SPECIAL
A	

The objective of this program is to develop the production engineering techniques for multiple rod fabrication of Nd:YAG laser materials to a set of specifications typical of a system rod.

ABSTRACT

The polishing fixture designed to hold sixteen rods during fabrication was received during this quarter. Using this fixture several lots of rods were processed to evaluate the proposed polishing process. Process data, times and yields were obtained. Rods were measured for adherence to specifications and data collected as a function of rod position within the block.

## TABLE OF CONTENTS

	<u>Page</u>
ABSTRACT	ii
TABLE OF CONTENTS	iii
LIST OF FIGURES	iv
LIST OF TABLES	v
PURPOSE	vi
1.0 INTRODUCTION	1
2.0 FIXTURING AND TOOLING	1
3.0 MANUFACTURING PROCESS	3
4.0 DATA AND ANALYSIS	5
5.0 CONCLUSIONS	8
6.0 PROGRAM FOR NEXT QUARTER	8
7.0 IDENTIFICATION OF PERSONNEL	10
DISTRIBUTION LIST	11

LIST OF FIGURES

<u>Figure</u>	<u>Page</u>
1 Polishing Fixture	2

LIST OF TABLES

<u>TABLE</u>		<u>Page</u>
I	Manufacturing Process	4
II	Perpendicularity	6
III	Rod Data	7

**PURPOSE**

The purpose of this production engineering program is to develop the mechanical and optical processes for multiple rod fabrication of neodymium doped YAG laser material. Control of quality is to be obtained through test procedures designed to meet the specifications of a typical system rod.

## 1.0 INTORDUCTION

The object of this MM & TE program is to attain a polishing rate for Nd:YAG laser rods of twelve rods per eight hours. To attain this rate a polishing fixture was designed and constructed to hold sixteen rods such that both ends could be polished without remounting of rods. This fixture is to be used in conjunction with a polishing process similar to that used for processing single rods. The first experimental runs using this fixture were made during this quarter. Particular attention was made to the ability of the fixture and process to produce rods meeting the required specifications. In the following sections more detailed information on the fixture, process and the results obtained will be presented.

## 2.0 FIXTURING AND TOOLING

The polishing fixture to be used in the program was designed to hold sixteen rods during the grinding and polishing operations. The design of the fixture was reported in the First Quarterly Report. A photograph of the fixture is shown in Figure 1.

The two critical laser rod parameters which can be effected by the fixture design are rod end face perpendicularity and parallelism. If the rod mounting holes are not sufficiently perpendicular to the block face and parallel to one another perpendicularity would be effected. If the mounting holes are not straight then the rod could be stressed in mounting and thus yield poor parallelism.

One of the objects of the polishing runs made during this quarter was to verify that the required specification could be achieved. The results of the first runs indicate that the fixture will be capable

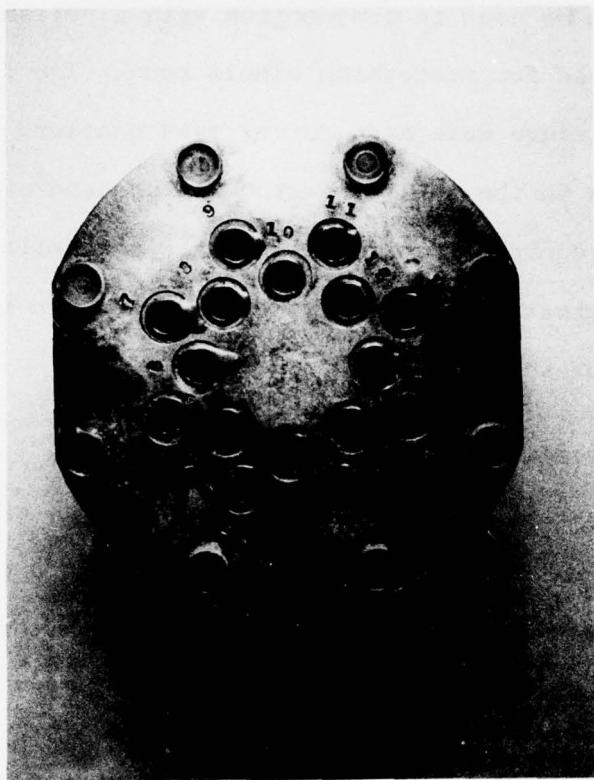


Figure 1. Polishing Fixture

of achieving the required specifications. All of the rods processed met the required perpendicularity, and all but one the required parallelism. A more complete discussion of the results is given in Section 4.0.

### 3.0 MANUFACTURING PROCESS

Rods are coredrilled, centerless ground and sized in preparation for mounting in the polishing fixture. The block is then heated with the rods in position and the rods are wax mounted. The assembly is cooled and the rod ends ground with a grinding wheel. At this point the rods are prepared for the final grinding and polishing operations.

The final grinding and polishing is composed of three grinding and two polishing steps for each of the two ends. The slurry composition, lap rotation rates and approximate material removals achieved are shown in Table I. Glass laps were used throughout the processing. In each case the slurry is prepared on the lap. If the slurry becomes too thick during the course of processing additional water is added as required.

The proper lap rotation rate is established prior to placing the block of rods on the lap. In processing, the block of rods is moved in a circular or figure eight pattern across the lap. The block is rotated by 90° after an approximately equal number of strokes in each direction. During first end processing frequent dimensional measurements are taken to assure that the surfaces are being worked evenly and proper perpendicularity achieved. Final perpendicularity is assured through use of an autocollimator.

TABLE I  
MANUFACTURING PROCESS

<u>Step</u>	<u>Slurry</u> <u>Grit</u> <u>(grams)</u>	<u>Water</u> <u>(ml)</u>	<u>Lap Rotation</u> <u>Rate (rpm)</u>	<u>Approximate</u> <u>Material removal (in.)</u>
Grind $20\mu \text{ Al}_2\text{O}_3$	50	50	8	0.002
Grind $12\mu \text{ Al}_2\text{O}_3$	40	40	8	0.0005
Grind $5\mu \text{ Al}_2\text{O}_3$	25	40	8	0.0003
Polish $1\mu \text{ Al}_2\text{O}_3$	10	50	8	0.0004
Polish $0.3\mu \text{ Al}_2\text{O}_3$	1	50	8	-

During processing surface finishes are frequently examined to assure that the work damage from the previous step is completely removed. When this is achieved the next step is started. The laps used are cleaned with soap and water between each processing step and are reground as necessary.

Upon achieving the specified surface finish and flatness on the first ends, the block is turned and the first ends covered to protect them from any possible contamination. Polishing of the second ends follows the same procedure used on the first ends. During the final steps, however, parallelism rather than perpendicularity is monitored.

When proper parallelism, surface finish and flatness of second ends are achieved, the process is complete and interferograms of each rod are recorded. The rods are then dismounted and submitted for testing. The results obtained applying this process to several groups of rods is discussed in the following section.

#### 4.0 DATA AND ANALYSIS

During the quarter thirty-two rods were processed on one end only for evaluation of perpendicularity and initial process data. Fifteen rods were processed both ends. This run yielded initial parallelism data as well as overall yield.

The results with respect to perpendicularity for all rods processed are shown in Table II. The perpendicularity requirement is five minutes. From the table it can be seen that all rods processed met this specification. The highest value measured was 3.5 minutes. Only one position in the block yielded consistently high values and that is still well within the required specification.

TABLE II

PERPENDICULARITY

<u>Position</u>	<u>Perpendicularity (min.)</u>		
	<u>Run I</u>	<u>Run II</u>	<u>Run III</u>
1	3.0	3.5	-
2	2.0	2.0	3.0
3	1.0	1.5	0.75
4	2.5	1.5	1.5
5	1.0	1.5	2.0
6	1.0	0.5	0.5
7	0.5	1.5	1.25
8	1.5	3.5	3.0
9	0.75	2.0	1.5
10	0.75	0.5	1.0
11	1.0	0.7	3.0
12	0.5	1.5	2.0
13	2.0	1.5	3.0
14	2.0	0.5	1.0
15	1.5	1.5	3.0
16	0.5	0.5	1.0

TABLE III

## ROD DATA

<u>Position No.</u>	<u>Parallelism (sec.)</u>	<u>Flatness (λ)</u>	<u>Surface Finish</u>
1	no	rod	
2	12	.1	0-0
3	<10	.1	0-0
4	<10	.1	0-0
5	<10	.1	0-0
6	16	.1	0-0
7	<10	.1	0-0
8	<10	.1	0-0
9	12	.1	0-0
10	25	.1	0-0
11	12	.1	Scratched & pitted
12	16	.1	0-0
13	<10	.1	0-0
14	<10	.1	0-0
15	16	.1	0-0
16	<10	.1	0-0

The results of the run where both ends were polished are shown in Table III. As can be seen flatness was no problem with all rods meeting the required specifications. On the critical areas of parallelism and surface finish only one rod was out of specification for each parameter. The overall yield was thus 13 of 15 rods processed.

Throughout the processing no major problems were encountered with either the fixture or manufacturing process. The actual time spent in grinding and lapping was minimal. The largest amount of time was spent in monitoring the critical parameters of perpendicularity, parallelism and surface finish.

#### 5.0 CONCLUSIONS

The results of the initial polishing experiments were very promising. The overall process yield of thirteen rods is above the 75% yield (12 rods) required from the block. No difficulties were encountered in achieving the required specifications with respect to critical rod parameters.

No overall process times have been obtained yet. Initial results, however, indicate that actual grinding and polishing times will not be a limiting factor. Future work will address the areas of actual process time and time spent in peripheral areas of monitoring flatness, parallelism, perpendicularity and surface finish. These areas will be significant in the determination of the overall process rate.

#### 6.0 PROGRAM FOR NEXT QUARTER

Polishing experiments using the fixture for processing both rod ends will continue during the next quarter. Additional information on process rates and yields will be obtained. Two critical areas that

will be addressed will be the method of rod mounting and its effect on parallelism and the method of monitoring parallelism during fabrication. Data on critical parameters will be obtained before and after dismounting of rods.

During the quarter assembly of test equipment will continue in preparation for first deliveries.

## 7.0 IDENTIFICATION OF PERSONNEL

The following is a list of the engineering and manufacturing personnel who contributed to the program during this quarter.

<u>Engineers and Technicians</u>	<u>Hours this Quarter</u>	<u>Cumulative Hours</u>
Dentz, D.	160	280
Turner, S.	40	80
Belt, R.	20	35
Lowe, I.	25	35
O'Neill, J.	40	50
Manufacturing	<u>75</u>	<u>75</u>
<b>TOTALS</b>	<b>360</b>	<b>555</b>

DISTRIBUTION LIST

Contract DAAB07-77-C-0375

	<u>Copies</u>
Defense Documentation Center ATTN: DDC-TCA Cameron Station (Building 5) Alexandria, VA 22314	3
Director of Defense R & E ATTN: Technical Library Room 9E-1039, The Pentagon Washington, D.C. 20301	1
The University of Michigan Institute of Science and Technology ATTN: IRIA Library PO Box 618 Ann Arbor, Michigan 48107	1
Chief of Naval Research ATTN: Code 427 Department of the Navy Washington, D.C. 20325	1
Naval Ships Systems Command ATTN: Code 20526 (Technical Library) Main Navy Building, Room 1528 Washington, D.C. 20325	1
Air Force Avionics Lab. ATTN: TEA-4 (Mr. James Skalski) Wright-Patterson Air Force Base, OH 45433	1
Advisory Group on Electron Devices ATTN: Secretary, SPGR on Optical Masers 201 Varick Street New York, NY 10014	2
Institute Defense Analysis ATTN: Mr. Lucien M. Biberman 400 Army - Navy Drive Arlington, VA 22202	1
Commander US Army Electronics Command ATTN: DRSEL-CT-DT (Mr. Bernard Louis) Fort Monmouth, NJ 07703	1

Copies

Commander US Army Electronics Command ATTN: DRSEL-CT-L (Mr. J. Strozyk) Fort Monmouth, NJ 07703	2
Commander US Army Electronics Command ATTN: DRSEL-PP-I-PI-1 (Mr. J. Sanders) Fort Monmouth, NJ 07703	2
Air Force Materials Laboratory ATTN: AMSL (LTE) Mrs. Tarrants Wright-Patterson Air Force Base, Ohio 45433	1
Commander US Naval Ordnance Laboratory ATTN: Technical Library White Oak, Silver Spring, MD 20910	1
Rome Air Development Center (EMTLD) ATTN: Documents Library Griffiss Air Force Base, NY 13440	1
Air Force Weapons Laboratory ATTN: WLIL Kirtland Air Force Base, New Mexico 07117	1
OFC, Assistant Secretary of the Army (R&D) ATTN: Assistant for Research Room 3-E-379, The Pentagon Washington, DC 20310	1
Chief of Research and Development Department of the Army ATTN: Mr. R. B. Watson Army Research Office Washington, D.C. 20310	1
Commander US Army Materiel Development & Readiness Command ATTN: DRCMT 5001 Eisenhower Avenue Alexandria, VA 22333	1
Commander US Army Electronics Command ATTN: DRSEL-CT (R. Buser) Fort Monmouth, NJ 07703	1

Copies

Division of Non-Ionizing Radiation  
Litterman Army Institute of Research  
Presidio of San Francisco  
San Francisco, CA 94129

1

Commander  
US Army Materials Research Agency  
ATTN: AMDME-ED (Mr. Raymond L. Farrow)  
Watertown, MA 02172

1

Director  
US Army Industrial Base Engineering Activity  
ATTN: DRXIB-MT(MR. C. E. McBurney)  
Rock Island Arsenal  
Rock Island, IL 61201

1

Hughes Aircraft Company  
ATTN: Company Technical Document Center  
6/E110  
Centinela at Teale  
Culver City, CA 90230

1

Allied Chemical Corporation  
Synthetic Crystal Products  
ATTN: Mr. Conrad Kass  
1201 Continental Blvd  
Charlottesville, NC 28234

1

Crystal Technology Inc.  
ATTN: Fr. F. A. Halden  
2510 Old Middlefield Way  
Mountainview, CA 94040

1

Union Carbide Corp  
ATTN: Mr. Wayne Edwards  
8888 Balboa Ave  
San Diego, CA 92123

1

NASA Manned Spacecraft Center  
ATTN: TF4, Mr. Ray R. Clemence  
Houston, TX 77058

1

Dr. Fred W. Quelle  
Office of Naval Research  
495 Summer Street  
Boston, Massachusetts 02210

1

Copies

Bell Telephone Laboratories, Inc.  
ATTN: Technical Reports Center WH2A-160  
Whippany Road  
Whippany, NJ 07981

1

Commander  
Harry Diamond Laboratory  
ATTN: AMSDC-RCB (Mr. R. G. Humphrey)  
Washington, DC 20438

1

A handwritten signature consisting of a stylized 'H' or 'J' shape with a horizontal stroke extending to the right.